


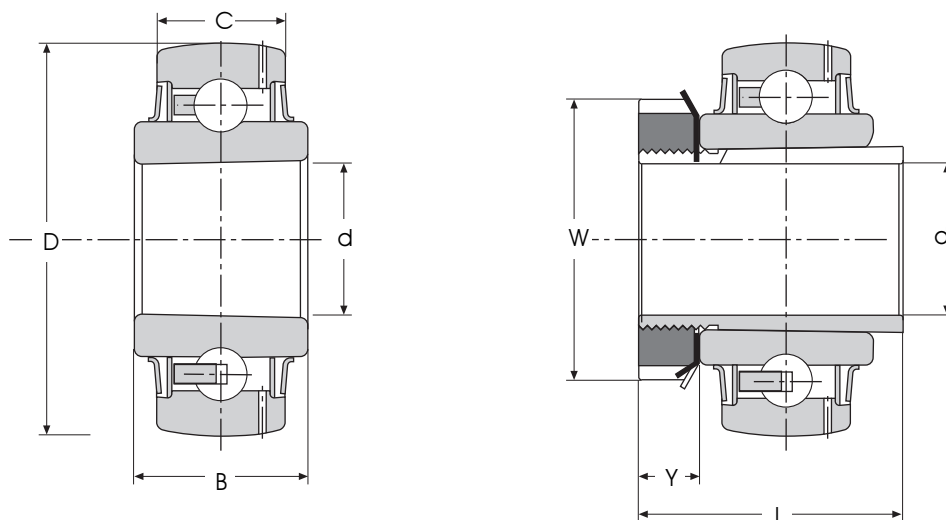

Manchons à commander séparément

Symboles	Dimensions en mm								Charges en kN		Poids kg
	d ₁	D	d	B	C	L	Y	W	Dyn. c kN	Stat. c ₀ kN	
UK 205 + H ...	20	52	25	21	17	35	8	38	14	7,8	0,24
UK 206 + H ...	25	62	30	29	19	38	8	45	19,5	11,3	0,34
UK 207 + H ...	30	72	35	27	20	43	9	52	25,5	15,3	0,53
UK 208 + H ...	35	80	40	29	21	46	10	58	32,5	19,8	0,69
UK 209 + H ...	40	85	45	30	22	50	11	65	32,5	20,4	0,77
UK 210 + H ...	45	90	50	31	23	55	12	70	35	23,2	0,93
UK 211 + H ...	50	100	55	33	27	59	12	75	43,5	29	1,16
UK 212 + H ...	55	110	60	36	27	62	13	80	52	36	1,47
UK 213 + H ...	60	120	65	36	28	65	14	85	62	44	1,82
UK 215 + H ...	65	130	75	41	30	73	15	98	62	44,5	2,59
UK 216 + H ...	70	140	80	44	33	78	17	105	72	54	3,27
UK 217 + H ...	75	150	85	44	35	82	18	110	85	65	3,92
UK 218 + H ...	80	160	90	48	38	86	18	120	96	72	4,68